



R64PMK - Té m   renvers   orientable - BSPP

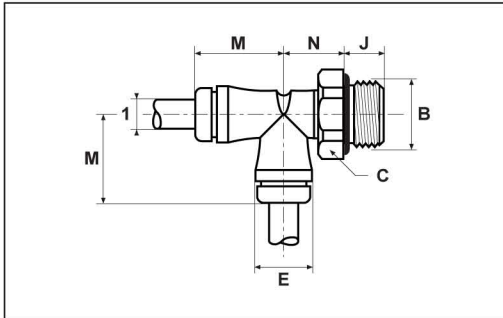


1	B	D��signation	C	E	J	M	N	Masse g.
4	1/8	R64PMK4-1/8	13	8,5	5,0	12,65	8,2	7
4	1/4	R64PMK4-1/4	16	8,5	5,5	12,65	8,2	7
6	1/8	R64PMK6-1/8	13	11,5	5,0	16,70	11,7	8
6	1/4	R64PMK6-1/4	16	11,5	5,5	16,70	9,7	9

R68PMK - T   m   renvers   orientable - m  trique cylindrique

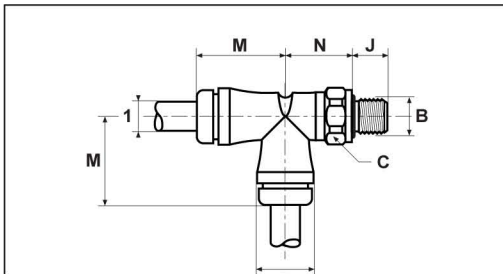

1	B	D��signation	C	E	J	M	N	Masse g.
3	M3x0,5	R68PMK3M3	7	7,3	3,25	11,25	9,2	6
3	M5x0,8	R68PMK3M5	7	7,3	3,50	11,25	9,2	6
4	M3x0,5	R68PMK4M3	8	8,5	3,25	12,65	9,8	7
4	M5x0,8	R68PMK4M5	8	8,5	3,50	12,65	9,8	7
6	M5x0,8	R68PMK6M5	11	11,5	3,50	16,70	11,7	8

R64PK - T   m   renvers   orientable - BSPP

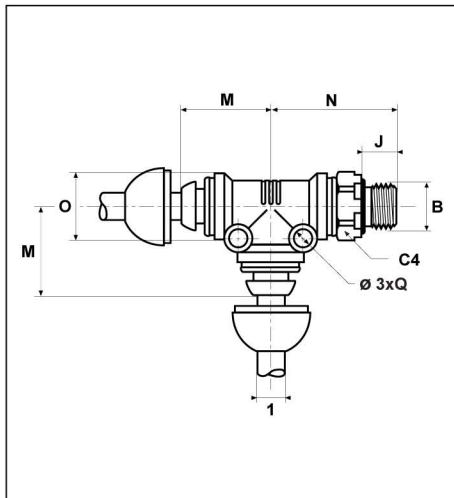

1	�� 3	B	D��signation	C4	J	M	N	O	Largeur Q	Masse g.
4	3,2	1/8	R64PK4-1/8	14	6	18,0	25,5	13	15,0	18
4	3,2	1/4	R64PK4-1/4	19	9	18,0	30,5	13	15,0	34
6	4,2	1/8	R64PK6-1/8	14	6	20,5	27,0	15	17,0	21
6	4,2	1/4	R64PK6-1/4	19	9	20,5	32,0	15	17,0	32
8	4,2	1/8	R64PK8-1/8	14	6	22,5	29,0	17	19,0	26
8	4,2	1/4	R64PK8-1/4	19	9	22,5	34,0	17	19,0	38
8	4,2	3/8	R64PK8-3/8	22	9	22,5	35,0	17	19,0	53
10	4,2	1/4	R64PK10-1/4	19	9	28,5	39,0	21	23,5	52
10	4,2	3/8	R64PK10-3/8	22	9	28,5	40,0	21	23,5	68
12	4,2	1/4	R64PK12-1/4	19	9	30,0	40,5	23	25,5	66
12	4,2	3/8	R64PK12-3/8	22	9	30,0	41,5	23	25,5	70
14	4,2	3/8	R64PK14-3/8	22	9	33,5	45,0	25	27,5	88
14	4,2	1/2	R64PK14-1/2	27	12	33,5	49,5	25	27,5	117

Les raccords sont livr  s sans cape de protection. Voir page B18.

Disponibilit   des pi  ces : consulter notre tarif 0093-FR.

Les dimensions des pi  ces sont donn  es    titre indicatif, nous nous r  servons le droit de les modifier sans pr  avis.